

LS251D

Leeb Hardness Tester

User Manual V1.32

Please read this manual carefully before using and reserve it for reference.

I. Product Introduction

The Leeb hardness tester detects hardness based on the Leeb hardness measurement principle and can measure the hardness of a variety of metal materials. The tester adopts advanced digital probe technology, digital signal processing is done directly on the probe, which is not easily disturbed and provides excellent testing accuracy. The probe has a built-in direction sensor, which automatically compensates for the measurement error in different impact directions. The instrument has a variety of built-in hardness systems, which can be converted between Leeb (HL), Vickers (HV), Brinell (HB), Shore (HS), Rockwell (HRA), Rockwell (HRB), Rockwell (HRC) and tensile strength (σ_b). The instrument adopts an impact device D suitable for assessing the hardness of common metal materials.

Standards for the product:

- GB/T 13794.1 Metallic materials-Leeb hardness test-Part 1: Test method
- GB/T 13794.2 Metallic materials-Leeb hardness test-Part 2: Verification and calibration of hardness tester
- GB/T 13794.2 Metallic materials-Leeb hardness test-Part 3: Calibration of reference blocks
- GB/T 13794.4 Metallic materials-Leeb hardness test-Part 4: Tables of hardness values conversion
- JB/T 9378-2001 Industry standard of Leeb hardness tester
- JJG 747-1999 Verification regulation of Leeb hardness tester

II. Parameters

Probe	Impact device D
Hardness Scales	HL, HV, HB, HS, HRA, HRB, HRC
Measurement Range	HLD: (170-960); HV(83-976); HB(30-651); HRC(17.6-68.5); HS(26.4-99.5); HRB(13.5-100); HRA(60-85.8)
Resolution	1HL
Accuracy	± 12 HL, ± 6 HL (typical)
Repeatability	6HL
Display	240 * 16 dot matrix LCD

Power Supply	2 AA alkaline dry batteries
Host Size	142*72*28 mm
Probe Size	148*31*25 mm
Weight	247g
Working Temperature Range	-10~50°C, 0~85%RH (no condensation)
Storage Temperature Range	-10~60°C, 0~85%RH (no condensation)


III. Features

1. The tester uses advanced digital probe technology, digital signal processing directly on the probe to complete, which is not easy to interfere with and provides excellent test accuracy.
2. Built-in direction sensor, automatically compensates for the measurement error of different impact directions.
3. Providing a variety of hardness scales to switch, no more tedious manual check table
4. QC inspection, the tester can set upper and lower limits to determine whether the incoming material is qualified and achieve rapid detection of incoming material.
5. Statistics function, the tester can automatically count the maximum value, minimum value, and average value of the last 9 measured values.
6. Users can calibrate the standard parts to eliminate the error.
7. Low power consumption, powered by 2 AA alkaline batteries and it can work continuously for more than 100 hours.


IV. Operation

1. Power on/off

Power on:

Short press  Enter button, the version and the serial number of the tester are displayed on the screen after powering on, and then the instrument will enter the measurement interface and the measured values before powering off are displayed.

Power off:

Long press the  button to shut down the tester or click the “Shutdown” option in the menu, the instrument will automatically shut down when the time without any operation is longer than the auto-shutdown time.

2. Measurement

Loading:

Push down the loading sleeve of the probe to lock the impact body.

Positioning:

Press the probe firmly against the surface of the object to be measured and keep it still.

Measurement:

Press the release button on the top of the probe to measure the hardness of the object.


There are two measurement modes:

(1) Statistics mode

The interface of statistics mode is shown below (left). The instrument displays the maximum value, minimum value, and average value of current statistics as well as the number of valid data. The number of statistics is the last 9 valid measurement data, and when there are less than 9 data, the actual amount of data prevails.

(2) QC mode

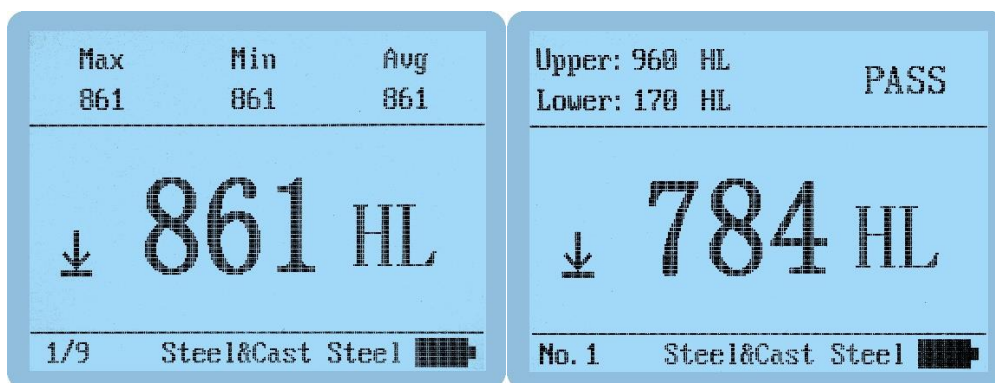


The QC mode interface is shown in the figure below (right), and the instrument judges whether the measured value is qualified according to the set upper and lower limits.




Statistics mode







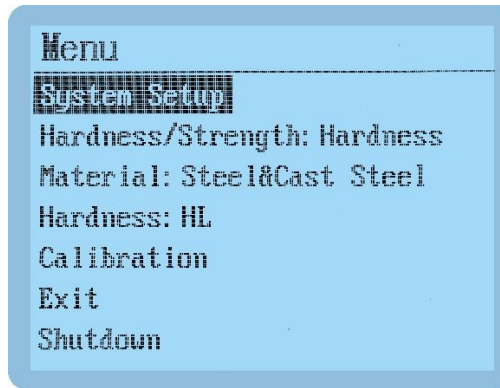













QC mode

3. Setup and Calibration

Press and hold the  Enter button for 3 seconds in the off state or press the  Enter button briefly in the measurement state to enter the Main Menu of the instrument with seven sub-options, press the ▲ and ▼ briefly to select [System Setup, Hardness/Strength, Material, Hardness, Calibration, Exit, Shutdown], short press the  Enter button to confirm the selection.





(1) System Setup





- Language: Short press  Enter button or  Del button to enter the language option and press the ▲ or ▼ button to select the right language, then press  Enter button to confirm your selection.
- Auto power off: short press the  Enter button or  Del button to enter the shutdown time selection, short press the ▲ or ▼ button to select the shutdown time, short press the  Enter button to confirm.
- Mode selection: short press the  Enter button or  Del button to enter the mode selection interface, press  Enter button to select the measurement mode, then short press the  Enter button to confirm.
- Limit setting: Limit setting is only displayed in QC mode, short press the  Enter or  Del button to enter the limit setting interface, press ▲ or ▼ button to select [upper/lower limit/return] option, short press the  Enter to confirm your option, short press  Cal  Del ▲▼ to modify the value, finally, short press the  Enter button to confirm the whole setting.
- Restore factory settings: Press the  Enter button briefly to enter the restore factory selection interface.  Cal  Del button can toggle the [Yes/No] option, press the  Enter button briefly to confirm

the option and return to the setting interface.



(2) Hardness/Strength

Short press  button to enter hardness/strength selection interface, and short press the ▲ or ▼ button to select [hardness/strength], then short press the  button to confirm the selection.



(3) Material




Short press the  button to enter the material selection interface, short press the   ▲▼ button to select the corresponding material, then press the  button to confirm the option and return to the setting interface.

(4) Hardness Unit


The hardness unit is only displayed in hardness measurement mode, press the  button briefly to enter the hardness unit selection interface, press the ▲ or ▼ to select the hardness unit, press the  button briefly to confirm.

(5) Calibration


Short press the  button to enter the calibration interface, the screen prompts [Please measure the standard hardness block] and flashes, then you can measure the standard hardness block (single or multiple times). After measurement, the cursor moves to the actual value area, then press ▲ or ▼ button to adjust the actual value to the standard value of the hardness block. Short press the  button to end the adjustment, and press the ▲ or ▼ to select [Cancel]/[Back]/[Save] options.

- Select [Cancel] and press  button briefly to return to the calibration screen and wait for the measurement again.
- Select [Back], short press  button to not save the calibration data and exit the calibration screen.
- Select [Save], press  button briefly to save the current calibration data, and exit the calibration interface.

(6) Exit

Short press  button briefly to exit the main interface and enter the measurement interface.



(7) Power off

Short press  button to power off the instrument.

4. History Records

In the measurement mode, press ▲ or ▼ briefly to view the historical data in the browse interface. The instrument stores 9 sets of data totally, and the oldest recorded value is automatically deleted when there are more than 9 sets of data. Record 1 is the earliest test data, and so on backward. Recorded data is not lost when the instrument is turned off.

When pressing ▲ button to view the data, the data record number is increasing from the first one to the last one; when pressing ▼ button to view the data, the data record number decreases from the maximum to the minimum.

In the history view mode or measurement mode, press  button briefly and the screen will show a data deletion prompt, press  button briefly to select [Yes] to delete all recorded data.

5. Quick access to the calibration interface

In measurement mode, short press the button to check historical data. The gauge stores 9 sets of data. When more than 9 sets of data are stored, the earliest recorded value is automatically deleted, and “No.1” is the last test data. Recorded data will not be lost after powering off.

V. Attentions

1. The surface of the test object shall not be too rough, and it needs to be flat, smooth, free of oil and grease, transmitting a metallic luster.
2. The minimum mass of the test object is 5Kg, and the minimum thickness is 25mm. For objects whose weight and thickness do not meet the requirements, the test must be coupled with solid bracing.
3. The maintenance of the impact device. After using the device about 1000-2000 times, the user needs to use a nylon brush to clean the instrument's conduit and impact body. When cleaning, the user needs to unscrew the support ring of the catheter first, then remove the impact body, insert the nylon brush into the catheter in a counterclockwise direction, then pull out the bottom and repeat five times, and finally put the impact body and support ring.

4. After use, the impact body should be loosened.
5. The use of various lubricants is strictly prohibited in the impact device.
6. When measuring, the distance between any two indentations should not be less than 3mm, and the distance between the center of the indentation and the edge of the object to be measured should not be less than 5mm.
7. When the device displays “Low Battery”, batteries should be replaced.

VI. Packing list

No.	Product Name	Quantity	Unit
1	Leeb Hardness Tester	1	Set
2	Standard Leeb hardness block	1	pcs
3	Nylon Brush	1	pcs
4	Small support ring	1	pcs
5	1.5V AA alkaline battery	2	pcs
6	User Manual	1	pcs
7	Calibration Report	1	pcs
8	Certificate / Warranty card	1	pcs
9	Plastic Case	1	pcs

VII. Service

1. The gauge has one-year warranty. If the gauge works abnormally, please send the whole gauge to our company for maintenance.
2. Provide users with spare parts and lifelong maintenance services.
3. Provide the users with the gauge calibration service.
4. Free technical support for the long term.

Manufacturer: Shenzhen Linshang Technology Co., Ltd.

Website: www.linshangtech.com

Service hotline: +86-755-86263411

Email: sales21@linshangtech.com